## SATRON VO Turbidity and solids content sensor

**SATRON VO turbidity and solids content analyzer** is suitable for the measurement of different liquids. Savings can be obtained by using SATRON VO analyzer in process industries, e.g. the use of clean water can be minimized, the time used for the cleaning (CIP) will be shortened, the use of the end product (in dairy applications: milk) and the use of cleaning materials needed in the process can be optimized. The transmitter communicates digitally using the HART® protocol.



#### TECHNICAL SPECIFICATIONS

## Measuring range and span See Selection Chart.

#### Zero and Span adjustment

Zero elevation: Calibrated span is freely selectable on the specified range depending from the desired option. This can be made by using keyboard (display option) or HART®275/375 communicator.

#### **Damping**

 Time constant is continuously adjustable 0.01 to 60 s.

#### Repeatability

- 0.1% from maximum span.

#### **Temperature limits**

Ambient: -30 to +80 °C Process: 0 to +100 °C / +140 °C (VOF) -5 to +100 °C / +140 °C (VOM & VOD) Shipping and storage: -40 to +80 °C.

Output 3-wire (3W), 4-20 mA

#### Supply voltage

Nominal 24 VDC, (21,6 - 27,6V)

Humidity limits 0-100 % RH

#### EMC directive 2004/108/EC

- EN 61326-1:2005

## CONSTRUCTION Materials:

Sensing element <sup>1)</sup>: AISI316L, Duplex (EN. 1.4462), Hast. C276/C22, or Titanium Gr2.

Surface quality: Polished Ra <0,8µm Lens: quartz glass, Safir glass or PC plastic

Coupling 1): AISI316L, Duplex (EN 1.4462), Hast.C276 or Titanium Gr2 Other sensing element materials: AISI316, SIS 2343.

#### Pressure class:

- PN40
- Test pressure -1 to 30 bar

# Housing with display, codes NOS & NOT:

Housing: AISI303/316, Seals: Nitrilerubber and Viton®, Nameplates: Polyester

**Housing with M12 connector,** code **H0T:** Housing: AISI303/316, Seals:

Viton® and NBR.

# Housing with PLUG DIN 43650 connector, code H0S:

Housing: AISI303/316, Seals: Viton® and NBR.

PLUG connector: PA6-GF30 jacket, Silicone rubber seal, AlSI316 retaining screw.

# Connection hose between sensing element and housing

Codes L and R:

PUR signal cable or hose protected with PTFE/AISI316 braiding

#### Calibration

For customer-specified range with minimum damping. (If range is not specified, transmitter is calibrated for maximum range.)

#### **Electrical connections**

Housing with PLUG connector, code **Hos:** 

Connector type DIN 43650 model AF; Pg9 gland for cable; wire cross-section 0.5 to 1.5 mm².

Housing with M12 connector, code **H0T**: M12 plug connector

Housing with display, code **N0S**: Connector type DIN 43650 model AF; Pg9 gland for cable; wire cross-section 0.5 to 1.5 mm<sup>2</sup>.

Housing with display, code **N0T**: M12 plug connector

#### I/O-connections

bout1-3

Relay, grounding contact
Maximum voltage 35 V
Maximum current 50 mA
Maximum leakage current 10 µA

bin1-3

NC (no connection) OFF O...2 V ON

Minimum values for switch in use
Voltage 16 V
Current 4 mA
Leakage current 1 mA

Current output1

 $\begin{array}{lll} \text{Range} & 3.5...23 \text{ mA} \\ \text{Maximum load} & 600 \ \Omega \\ \text{Factory setting} & 4...20 \ \text{mA} \\ \end{array}$ 

Current output2 Internal power supply Current output 2 has same ground as binary IO Maximum load 400  $\Omega$  Range 3.5...23 mA Factory setting 4...20 mA External power supply Current output 2 is galvanically isolated

Maximum supply voltage 35 VDC Range 3.5...23 mA Factory setting 4...20 mA Maximum load, See picture below Maximum isolation voltage 100 VDC


#### **Process connections**

- With G1 connecting thread
- Tri-Clamp 25/38 and 40/51

Protection class: See Selection chart.

#### Weight

Housing with PLUG DIN43650
connector (H0T): 0.9 kg
Housing with M12
connector (H0S): 0.9 kg
Housing with display
(N0S & N0T): 1.3 kg
Remote Housing (L): 2.5 kg
Remote sensor (R): 2.5 kg

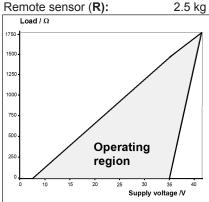

Min. load using HART®communication 250 R
R max = Supply voltage -5 V
I max

I max = 20,5 mAI max = 22,5 mA

(when the alarm current 22,5 mA is on)


Current output 2 External power supply





<sup>1)</sup> Parts in contact with process medium

# **BA200** rev. 9.6


## **Dimensions and Housing types VOM**

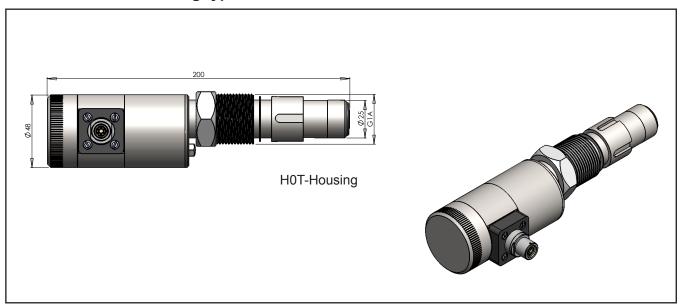

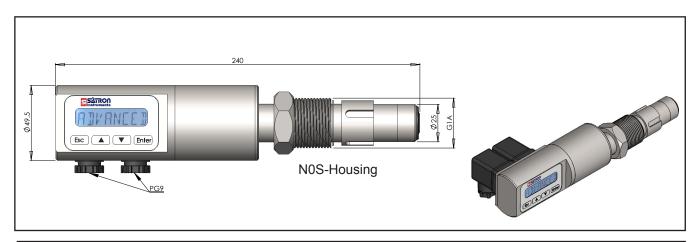


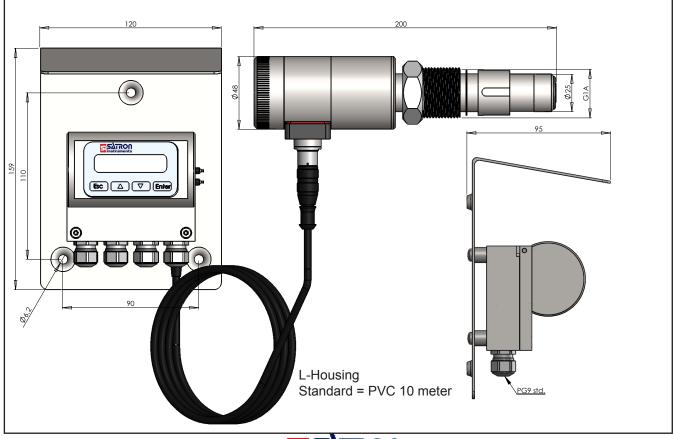



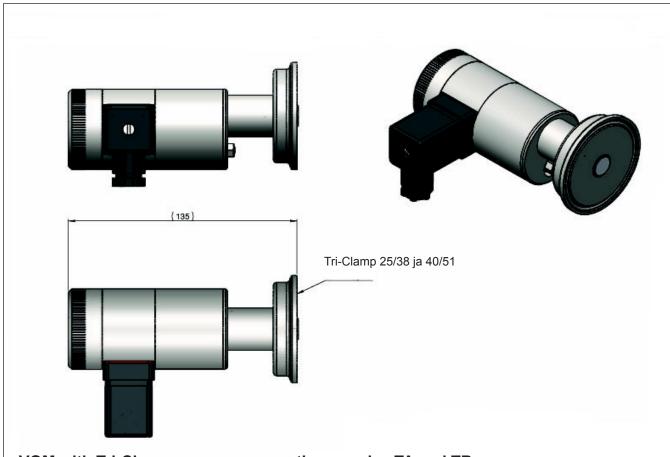



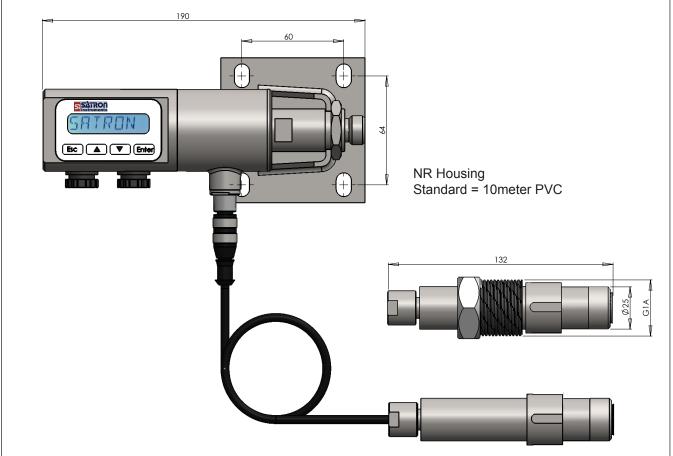



VOM with remote sensor, housing type code R



# **SATRON VO** Turbidity and solids content analyzer



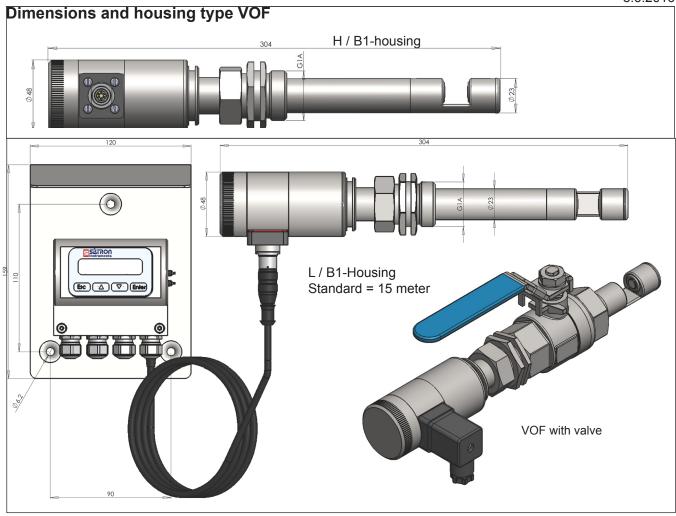

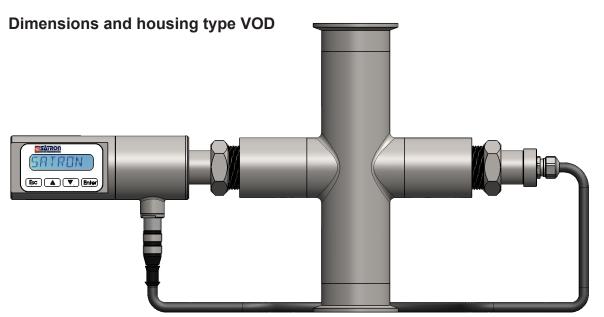

For easy installation the VOD is standard equipped with Tuchenhagen Type N but is is available with many different process connections. The process pipe is NOT included.

Contact Satron for other possibilities, the picture above is a VOD equipped with G1" process connection, and a pipe with 51 Tri-clamp.



## **SATRON VO** Turbidity and solids content analyzer



Welding assistant M1050420

Polished Ra <0,8

## Instructions and spare parts that are according and within the 3-A appliance



Welding Sequence

1

4

6

3

2

5

#### Welding the coupling


These instructions apply to hygienic welded couplings; welding the G1 standard coupling is described here as an example.

- · Place the coupling in the mounting hole as shown in Fig. 1-4. Make sure the leakage detection port is down. Then weld with several runs so to prevent the coupling's oval distortion and tightness problems. The inside welding must be cleaned, and polished with an end result of Ra < 0.8
- The analyzer must be **out of the coupling** while the coupling is welded. You can use the shut-off plug shown in Fig. 1-5 to shut the coupling. The plug protects the coupling's sealing face and permits the starting of the process without the transmitter.
- It is always recommendable to use the welding assistant (M1050450) while welding the coupling to prevent any distortions due to heat.
- Do not make weld grounding via any analyzer's body!

#### Mounting the analyzer on the coupling

#### **Procedure**


- Make sure that the coupling's sealing face is clean.
- Remove the orange protective plug from the analyzer head.
- Insert the analyzer in a straight line into the coupling, so that the guide groove on the transmitter aligns with the stop pin on the coupling. The analyzer settles into position when the groove and pin are aligned, and will be prevented from rotating in the coupling.

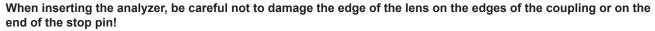

• Lock the transmitter in position by screwing the hex nut fully home. Finger tightness is sufficient to tighten the sealing faces. However, we recommend final tightening with a tool to eliminate the effect of vibration and other such factors. Apply 60±20 Nm torque.

#### Do not use sealing tape etc. on threaded connection!

#### Spare parts

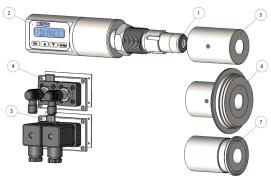

No.	Part name	Order code
1	O-ring EPDM	80031720
1	O-ring FPM (Viton®)	80011720
1	O-ring FFPM(Kalrez®)	80041717
2	Sticker	T1325215
3	Plug cover DIN43650	T1325003
4	Plug cover M12	T1325005
5	38/G1" Welding adapter	M1050577A
5	45/G1" Welding adapter	M548101A
6	Tuchenhagen / Varivent DN25	M1050090A
6	Tuchenhagen / Varivent DN50	M1050091A
6	Tuchenhagen / Varivent DN65,5	M1050092A
7	Tri-clover 25/38 ISO2852	M1050206A
7	Tri-clover 40/51 ISO2852	M1050222A
7	Tri-clover 63.5 ISO2852	M1050224A

3A 18-03 Class II

3A 18-03 Class I 3A 18-03 Class I

Note

(Do not exceed above 8% fat content).





#### Housing with display, code N

#### Keyboard:

Esc = Press **Esc** move back towards the top of the main menu.


■ Use the UP arrow key to move up on the current menu level or to increase the selected parameter value.


■ Use the DOWN arrow key to move down on the current menu


level or to decrease the selected parameter value.


Enter = Press ENTER to move to a lower level in a menu or to accept


Enter = Press ENTER to move to a lower level in a menu or to accept a command or parameter value

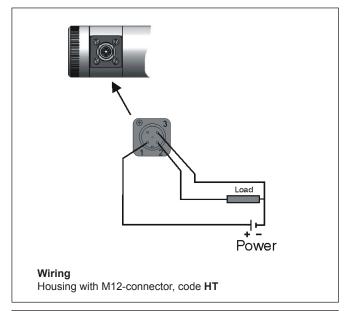


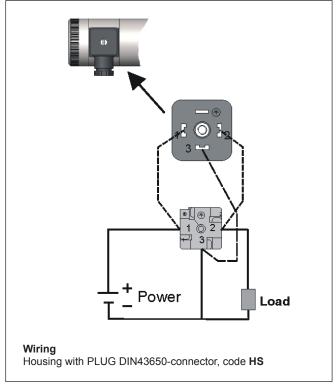

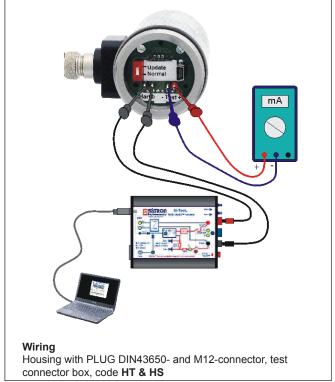

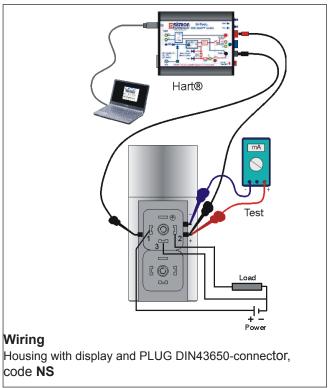


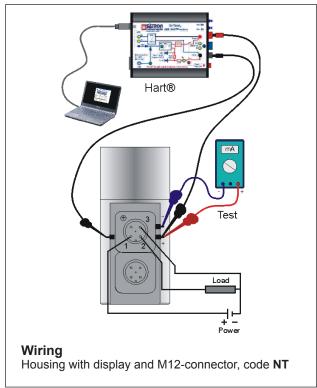

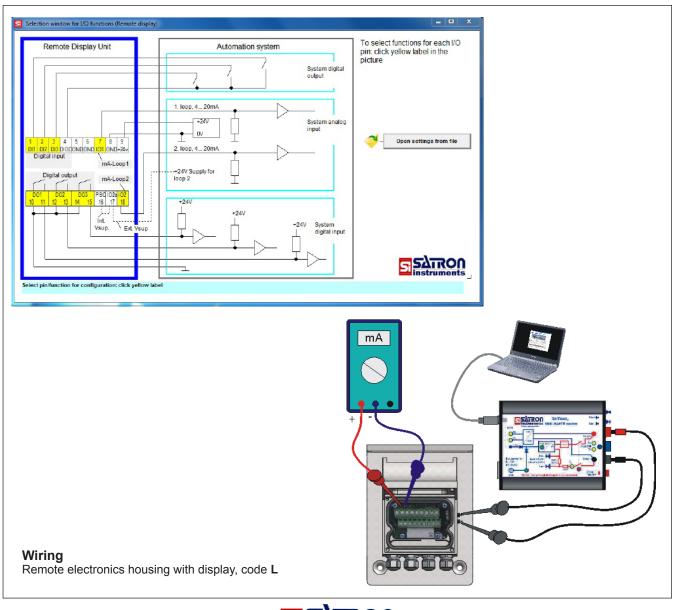



### **Selection Chart**

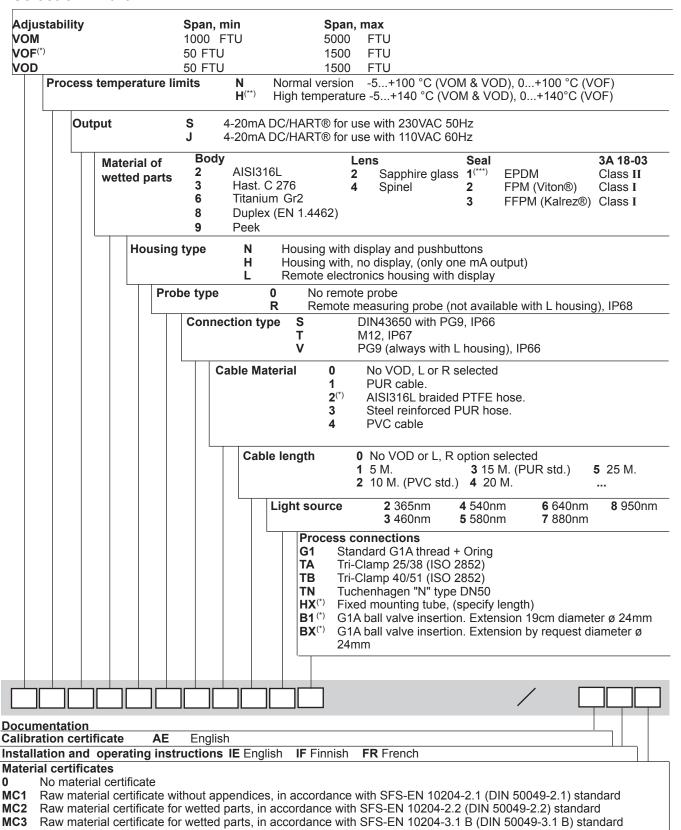

<sup>\*</sup> Not EHEDG certified & Not within the 3A approval

\*\*\* Do not exceed above 8% fat content.





We reserve the right for technical modifications without prior notice.

HART is the registered trademark of HART Communication Foundation. Pasve is the registered trademark of Satron Instruments Inc. Hastelloy is the registered trademark of Haynes International. Viton is the registered trademark of DuPont Down Elastomer. 3-A is a registered mark owned and administered by 3-A SSI.



<sup>\*\*</sup> Only in combination with Quartz, Sapphire lens and Kalrez Seals. And only 880nm